

# Manhole Inspection Summary

Manhole # S19A\_\_006MH

Printed On: 3/10/2009

Page 1 of 3

**Inspection** ☐ Is Incomplete Rating: **2) Good**

Record Plat: **19A** Node: **006** Status: **Found**

Insp Date: **10/24/07 10:06 AM**

Incomplete Comments

Crew: **ADS4**  
Inspector: **ADS4**  
Firm: **ADS**

**Location** Address: **2104 LANVALE ST**

Cross Street: **PULASKI ST**

**Manhole** Type: **Inline** Location: **Roadway** Ground Conditions: **Wet**

☐ Prev. Rehab Weather: **Light Rain** Subject To Ponding: **None**

Comments

**Cover** Shape: **Circular** Diameter: **30** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Cracked** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **2** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment** ☒ Exists Material: **Brick** ☒ Parged Height: **5** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel** Material: **Concrete** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel** Material: **Concrete** ☐ Parged

Shape: **Circular** Diameter: **52** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Bench** ☒ Exists Material: **Brick** ☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel** Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Steps** Count: **9** Missing: **0** ☐ Corroded

**Surcharge** ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

# Manhole Inspection Summary

Manhole # S19A\_\_006MH

Printed On: 3/10/2009

Page 2 of 3

Location View



Top View



Defect 4



INFILTRATION OF CORBEL AND  
BARREL JOINTS

Defect 3




DETERIORATED CHIMNEY

Defect 2



FRAME OFFSET

Defect 1

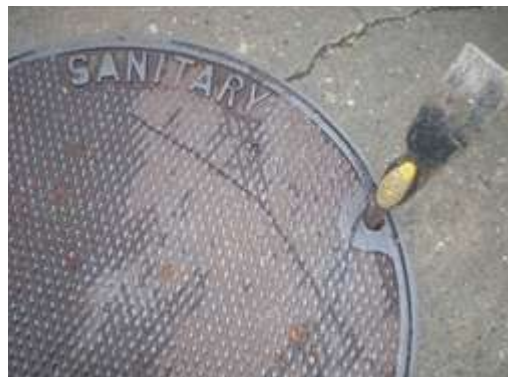

CRACKED LID

## Manhole Inspection Summary

Manhole # S19A\_\_006MH

Printed On: 3/10/2009

Page 3 of 3

8 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **7.2** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **11.40** (ft.) Flow Characteristics: **Slow**  
Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease  
Silt Depth: **1** (in.) Deposits Extent: **Light**  
Infiltration: **None** Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer  
Pipe In @ 5 O'Clock

5 O'Clock Inflow



Pipe Height: **7.2** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **11.27** (ft.) Flow Characteristics: **Slow**  
Deposits: ☒ **None** ☐ Mud ☐ Sludge ☐ Debris ☐ Grease  
Silt Depth: (in.) Deposits Extent:  
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection